




# SUNCOOL FABRICS

## F Screen 90

Openness  
Factor 3 & 5 %


FOCUS ON QUALITY

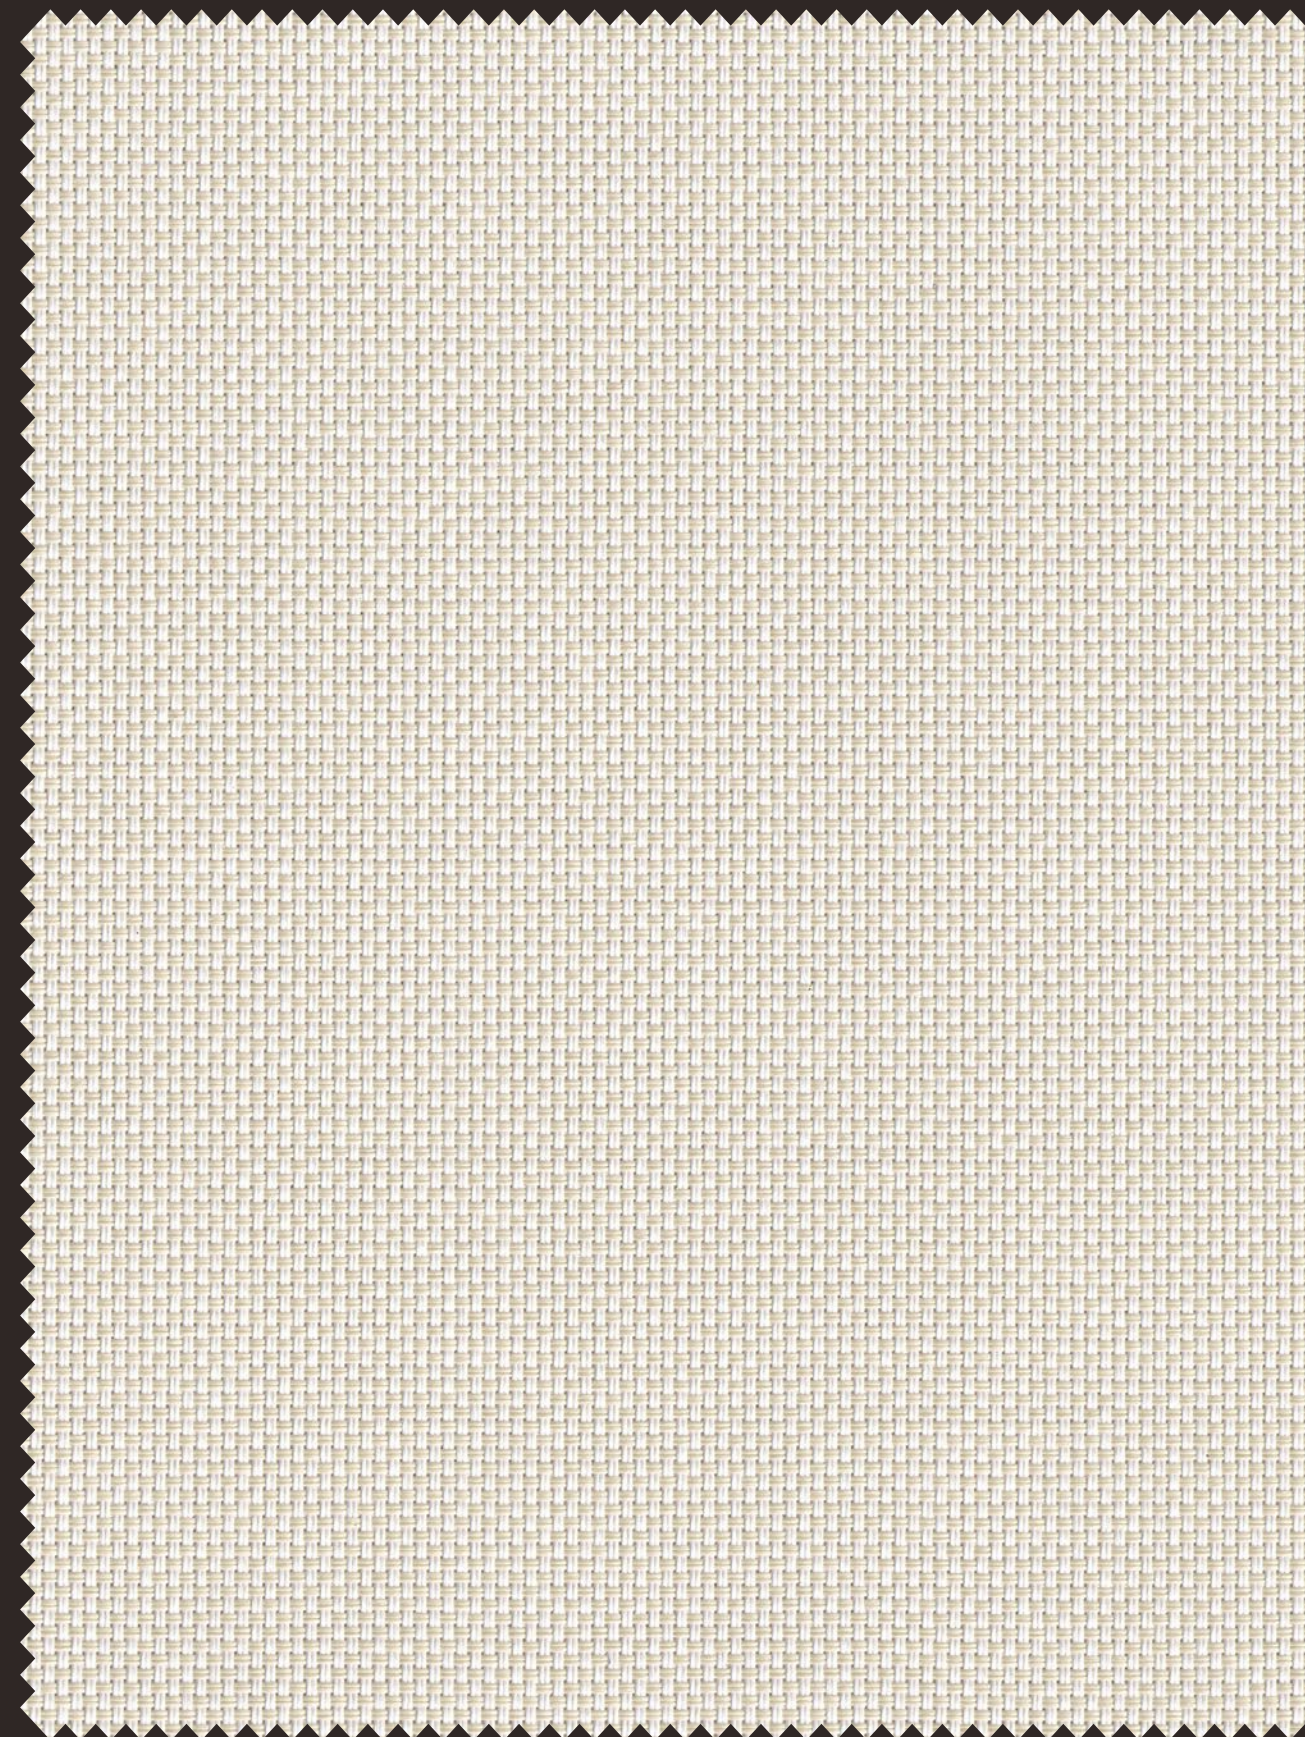


Cutting: Cold Cut, Ultrasonic, Crush Cut, or Laser  
Seaming / Hemming: Thermal, High-Frequency, Ultrasonic, or Sewing




F SCREEN 90

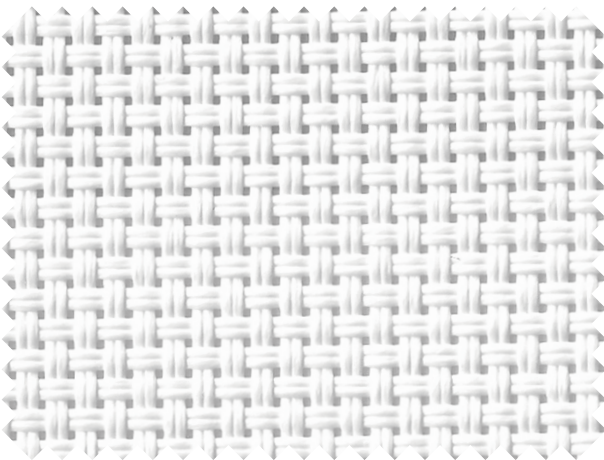

SC-F2-01 ( 3% & 5% )

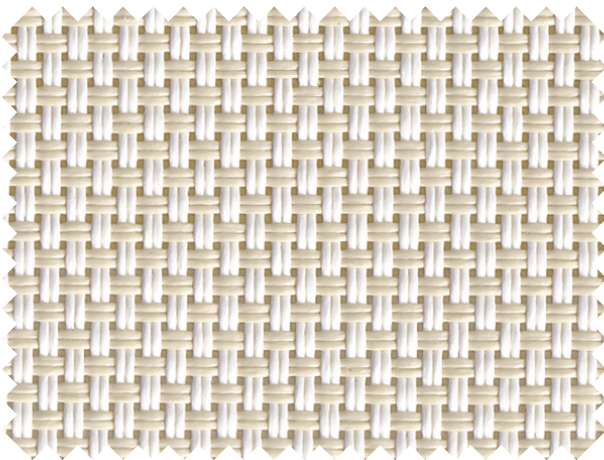

SC-F2-02 ( 3% & 5% )

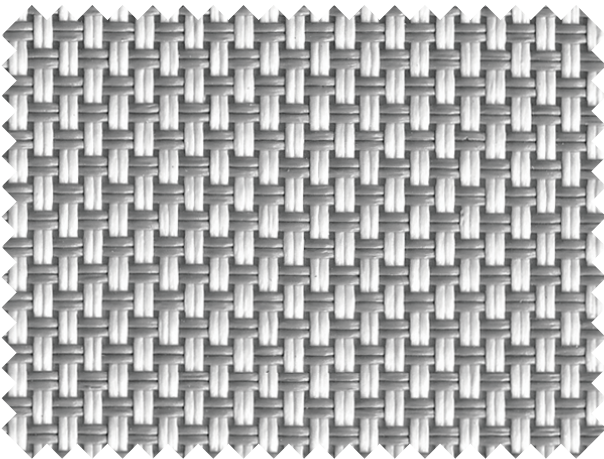

SC-F2-03 ( 3% & 5% )

TECHNICAL PARAMETER

COMPOSITION	30%Fiberglass + 70%PVC	
FINISHED WIDTH	118 inch	
THICKNESS	0.020" ± 5%	
WEIGHT	16.64 oz/yd² ± 5 %	
COLOR FASTNESS	8 Grade	
YARN COUNT	52 * 44	
BREAKING STRENGTH	Warp 1800 N/5cm	Weft 1800 N/5cm

3%

COMPOSITION	30%Fiberglass + 70%PVC	
FINISHED WIDTH	118 inch	
THICKNESS	0.019" ± 5%	
WEIGHT	15.96 oz/yd² ± 5 %	
COLOR FASTNESS	8 Grade	
YARN COUNT	48 * 46	
BREAKING STRENGTH	Warp 1700 N/5cm	Weft 1790 N/5cm

5%

PRODUCT CERTIFICATION

HEALTH CERTIFICATION	GREENGUARD GOLD、REACH、CHINA ENVIRONMENTAL LABELLING、GB/T 2912.1-2009、SGS
----------------------	--

BACTERIA AND FUNGAL RESISTANCE	ASTM G21 GB/T 31402-2015/ISO 22196:2007(IDT)
--------------------------------	---

FIRE RESISTANCE	B1 (CHINA)、NFPA701 (USA)
-----------------	--------------------------

COLOR FASTNESS	8 Grade
----------------	---------

WARRANTY	5-years
----------	---------

FABRICATION METHODS	Cutting: cold cut / ultrasonic / crush cut Seaming / Hemming: thermal / high-frequency / ultrasonic / sewing
---------------------	---

CARE AND CLEANING	Remove dust with vacuum cleaner or compressed air. Do not use solvents or any abrasive substance which might damage the coating of the fabric. Rinse with clean water. Leave the shade down until completely dry. You can also rub the fabric very gently with a clean white pencil eraser to remove small stains.
-------------------	---

